

 <b>SERVICE BULLETIN</b>	model number	ALL	bulletin number	00012
	for serial numbers	ALL		
	subject	EXTRANEIOUS NOTES		
	technical services approval	<i>J. R. Thomas</i>	writer	<i>J. R. T.</i>
	engineering approval	<i>[Signature]</i>	date	<i>4/23/74</i>

Technicians in the field have occasionally experienced the extraneous note phenomenon after completing the installation of a P-100 or P-101 reproducing system into an upright or grand piano. Extraneous notes are not programmed on the tapes, but play when a pre-recorded or locally recorded performance is played. If this extraneous note phenomenon occurs, make sure that the pedal solenoid cables are not tie wrapped with nor close to any other system wires or cables. Rerouting the pedal solenoid cables may solve the problem. If rerouting does not solve the problem, replace the playback logic board with the one from your DP-100. If replacing the playback logic board does not solve the problem, replace the original playback logic board. Next, unplug the PT-100 and plug on the PT-100 from your maintenance kit. If the new tape recorder does not solve the problem, check the AC power cable and the wall socket into which it is plugged. Be careful to plug the AC power cord into an outlet which will not be shared by any other electrical device (machine) which may cause a disturbance on the line thus creating extraneous notes. If the unit is plugged into an extension cable which is rated at an amperage less than the PIANOCORDER system uses, a hazardous condition will be created as well as the possible source for extraneous notes.

